



A DIVISION OF CLAPKE-GRAVELY CORPORATION

To continue its program of quality and design improvement, the manufacturer reserves the right to change specifications, design or prices without notice and without incurring obligation.

Technical Information

TECHNICAL SERVICE BULLETIN "E" - 78 - 1527

Date: June 16, 1978

To: All Gravelly Dealers, Branches and Distributors

Subject: Oil Blow-Out Through the P.T.O. Bearing on
5000 Series Tractors

We have received four reported cases of oil being blown out through the P.T.O. bearing in the quick hitch adaptor on the 5000 Series Tractors.

Investigation found the cause to be the air breather hole in the transmission oil filler plug not going through the filler plug.

The condition can be corrected by opening the hole in the filler plug. The incorrect plugs can be identified by four imperfections in the center of the plug.

Filler plugs on all tractors produced after April 27, 1978, serial number 334361 will have the hole open.

M. H. Lance, CSE
Manager, Customer Service