



TECHNICAL BULLETIN

Date: November 17, 1978

File Reference: D.I.B "E" - No. 1540

File Duration: Permanent

TO: Gravely Dealers, Branches and Distributors

SUBJECT: **800 Series Tractor Frame Service**

800 Series tractor frame, part number 21089, is being replaced by the present frame, part number 24353, for service.

To use the new frame on an old tractor, it will be necessary to drill one .406 diameter hole in the front link, part of the brake control, part number 21131.

The hole is to be drilled in the end of the front link opposite of the slot, two inches in from the present .406 diameter hole in the end.

The new hole is necessary to compensate for the relocation of the brake pedal on the new tractor.

M.H. Lance, CSE
Manager, Customer Service