



A DIVISION OF CLARKE-GRAVELY CORPORATION

To continue its program of quality and design improvement, the manufacturer reserves the right to change specifications, design or prices without notice and without incurring obligation.

# Technical Information

## TECHNICAL SERVICE BULLETIN - 1483

TO: ALL GRAVELY OUTLETS

DATE: OCTOBER 15, 1974

SUBJECT: WRONG U-JOINT PACKED WITH 50" ROTARY MOWERS,  
CODES "IYV" AND NYV"

Our Quality Control Department has advised that the 50" Rotary Mowers built in August and September of this year were sent out from our factory with the wrong u-joint packed with them. The code letters on these center-mount rotary mowers are "IYV" and "NYV".

Part number 20728P1 was packed in place of part number 13518P1. The only difference is the length of the two joints. Part number 13518P1 will measure 5 $\frac{1}{4}$ " from the end of the shaft to the center of the u-joint. Part number 20728P1 will measure 4" from the end of the shaft to the center of the u-joint.

Please advise the Order & Distribution Department if you have received the wrong u-joint. Upon notification, authorization forms will be sent for the return of part number 20728P1 and part number 13518P1 will be sent in return.

*Matthew Brown*  
Matthew N. Brown  
Customer Service Department

MNB/bh