

To continue its program of quality and design improvement, the manufacturer reserves the right to change specifications, design or prices without notice and without incurring obligation

Technical Information

TECHNICAL SERVICE BULLETIN "E" - 78 - 1530

Date: June 16, 1978

To: All Gravely Dealers, Branches and Distributors

Subject: G.M.T. Fuel Tank Fitting Torque

Recent reports of leaking fuel tanks on the G.M.T. have been traced to over tightening of the fitting in the bottom of the tank.

Proper torque for the fuel tank fitting is 8 to 10 footpounds. Excessive torque results in the rubber washer bowing and the tank leaking.

M. H. Lance, CSE

Manager, Customer Service