

ufacturer reserves the right to change specifications, deor prices without notice and without incurring obligation.

## **Technical** Information

## TECHNICAL SERVICE BULLETIN "E" - 78 - 1528

Date: June 16, 1978

To: All Gravely Dealers, Branches and Distributors

Subject: G.M.T. Engine Loss of Power and Inability to Maintain Idle Adjustment

The above problems have been traced to metal chips in the engine carburetor.

The chip condition resulted from the use of a screw to plug a hole in the upper left side of the carburetor. This procedure has been changed and the hole is now filled with a piece of foam material and covered with a metal bracket.

The above change was implemented on all tractors with serial number 00337392 and above.

Tractors with serial numbers 00317372, 317393, 317394, 317396, 317397, 317399, 317400, 337397, 337399 and 337400 have been corrected at the factory.

All other tractors should have the carburetors removed and thoroughly cleaned as soon as possible to ensure proper engine operation.

Cleaning of the carburetor will be covered under the warranty program. Allowed warranty time is one hour.

M. K. O an

M. H. Lance, CSE Manager, Customer Service